Medtronic

Medtronic International, Ltd. (Singapore Branch)

(Co.Reg.No. S98FC5604C) 50 Pasir Panjang Road #04-51 Mapletree Business City Singapore 117384

Tel: 165.6870.5300 Fax: 65.6482.0300

www.medtronic.com

URGENT: MEDICAL DEVICE CORRECTION


Becker and Exacta External Drainage and Monitoring Systems
Potential for Stopcock Cracking and Leaking

07 November 2024 | 20:09 SGT

Attention: Risk Management Director and O.R Materials Management CC: The Chairman Medical Board and relevant Head of Departments

Dear Healthcare Professional/ Risk Manager:

The purpose of this letter is to notify you of a medical device correction related to the Becker and Exacta external drainage and monitoring systems (EDMS). Specifically, there is the potential for cracking and leaking in the "stopcock" component on Becker and Exacta EDMS. Included in this notification are steps that can be taken to mitigate the issue. At this time, all lots of the products listed in Appendix A, with remaining shelf life, are impacted. Medtronic will issue a follow-up notification when updated or alternative product is available.

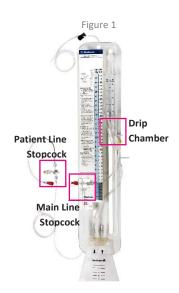

Issue Description:

Medtronic has received customer complaints reporting cracks and/or

leaks on the stopcock of Becker and Exacta EDMS devices. On these devices, the stopcocks may be in three different locations in the EDMS, depending on the specific system configuration (see Figure 1 for an example Becker system).

Cracks or leaks of the stopcock can compromise line integrity and, as a result, present a potential for infection. Three adverse events associated with patient infection have been reported.

FA1452_GlobalA_RegionalAM0 Page 1 of 6

Recommended Mitigations*:

- Prior to use, inspect all stopcocks and connections to ensure that connections are secure and that there are no visible cracks in the stopcocks. If cracks or leaks are identified, do not use the device and return it to Medtronic.
- The system must be pre-filled with sterile isotonic saline solution prior to connecting to the patient.
- Check all connections to ensure that fittings (connections) are tight and leak-free.
- All connections should be finger tightened. Over tightening can cause cracks and leaks to occur.
- After cleaning with alcohol, or a disinfectant containing alcohol, allow to air dry completely prior to connecting the system.

Patient Management Recommendations:

- If the system develops cracks or leaks during use, replace it using sterile technique and return the damaged system to Medtronic. If the leak occurs with the Patient Line Stopcock (see Figure 1), consider application of a hemostat or other clamp to the proximal patient line while coordinating a replacement if occlusion of the patient line does not create a risk to the patient.
- As stated in the product labeling, all patients with EDMS should be monitored for evidence of infection. If a system is found to have cracks or leaks, the system should be replaced, and the patient should continue to be monitored for evidence of infection.

Required Actions:

Please complete and return the enclosed customer confirmation form to acknowledge that you have read and understand this letter. Please post a copy of this notification near impacted product as a reminder of the issue and recommended mitigating actions. Retain a copy of this letter and completed response form for your records.

Additional Information:

Medtronic is working to address the potential for stopcock cracking and leaking. A follow-up notification will be issued when Medtronic is able to replace any unused Becker and Exacta products. Medtronic is communicating this information to the appropriate regulatory agencies. Adverse events or quality problems experienced with this product should be reported to Medtronic through Medtronic Customer Quality at rs.mnsprodexperiencehelp@medtronic.com.

FA1452_GlobalA_RegionalAM1 Page 2 of 6

^{*} The mitigations described are consistent with the instructions for use (IFU) for Becker and Exacta. Please refer to the IFU for full details.

We regret any inconvenience this may cause. We are committed to patient safety and appreciate your prompt attention to this matter. If you have any questions regarding this communication, please contact your local Medtronic field representative.

Sincerely,



Quality and Regulatory Affairs Director

Mainland and Island Southeast Asia

Enclosure: Customer Confirmation Form

FA1452_GlobalA_RegionalAM1 Page 3 of 6

Appendix A Product Scope:

| Product Names | Medtronic Product | GTIN |
|--|-------------------|----------------|
| | Number (REF) | |
| EDMS 24146 BECKER NO Y-SITE | 24146 | 00763000333423 |
| EDMS 24146 BECKER NO Y-SITE | 24146 | 00763000572839 |
| EDMS II 25120 BECKER W/1-WAY VALVE | 25120 | 00763000333430 |
| EDMS II 25120 BECKER W/1-WAY VALVE | 25120 | 00763000431297 |
| KIT 26040 BECKER EDMS II | 26040 | 00763000333447 |
| KIT 26040 BECKER EDMS II | 26040 | 00763000406066 |
| KIT 27581 EXACTA W/EDM VCATH 35CM | 27581 | 00763000333478 |
| BECKER 27609 W/NEEDLESLESS INJ. SITE | 27609 | 00763000333485 |
| BECKER 27609 W/NEEDLESLESS INJ. SITE | 27609 | 00763000529307 |
| EDM 27636 EXACTA W/BRAIDED CORD LOCK | 27636 | 00763000333492 |
| EDM 27666 EXCTA W GLUE STPCK GR PT LN | 27666 | 00763000333515 |
| BECKER 27670 STOP BELOW DC NDL-LS IN | 27670 | 00763000333522 |
| BECKER 27670 STOP BELOW DC NDL-LS IN | 27670 | 00763000529314 |
| BECKER 27672 ONEWAY VLV Y-SITE PT LN | 27672 | 00763000333539 |
| EDMS 27702 EURO BECKER II GR PT LN | 27702 | 00763000333553 |
| EDMS 27702 EURO BECKER II GR PT LN | 27702 | 00763000467326 |
| EDM 27732 EXACTA W/NDL-LS INJ. ST W/CAP | 27732 | 00763000333560 |
| BECKER 27761 STOP BCNDLESS PATLN 24 | 27761 | 00763000333577 |
| BECKER 27761 STOP BCNDLESS PATLN 24 | 27761 | 00763000529338 |
| BECKER 27767 NO STPCOCK ON PTLN 63 | 27767 | 00763000333584 |
| EDMS 27779 BECKER BC NDLESS BOND CONN | 27779 | 00763000333591 |
| EDMS 27779 BECKER BC NDLESS BOND CONN | 27779 | 00763000529345 |
| EDMS 27785 EXACTA 50ML BC NDLESS INJ | 27785 | 00763000333607 |
| EDMS 27795 EXACTA 100ML CATH | 27795 | 00763000333614 |
| EDMS 27811 BECKER GRN PL VCATH | 27811 | 00763000333638 |
| EDMS 27861 EXACTA 50ML ANTIRFLUX GRNPL | 27861 | 00763000333645 |
| EDMS 27873 BECKR W/SC BLW DC W/NLESS INJ | 27873 | 00763000333652 |
| EDMS 27931 BECKER GS TUBING SMARTSITES | 27931 | 00763000333669 |
| EDMS 27931 BECKER GS TUBING SMARTSITES | 27931 | 00763000467364 |
| EDMS 46128 BECKER II BLUE PT LN | 46128 | 00763000333676 |
| EDMS 46128 BECKER II BLUE PT LN | 46128 | 00763000406073 |
| EDMS 46129 EURO BECKER II BLUE PT LN | 46129 | 00763000333683 |

FA1452_GlobalA_RegionalAM1 Page 4 of 6

| EDMS 46129 EURO BECKER II BLUE PT LN | 46129 | 00763000431259 |
|--------------------------------------|-------|----------------|
| SYSTEM 46700 EXACTA DISP. DRAINAGE | 46700 | 00763000333690 |
| SYSTEM 46705 EXACTA DRAINAGE 100ML | 46705 | 00763000333706 |

Note: Kitted products may possess two CFNs, and the contents of the outer carton might have been removed and stored independently in the hospital inventory. The table above contains all CFNs (both outer carton and inner tray). Even if product is removed and stored outside of the outer carton, the listing above is inclusive of all impacted EDMS CFNs.

Below is an example of outer carton and inner tray labeling configurations:

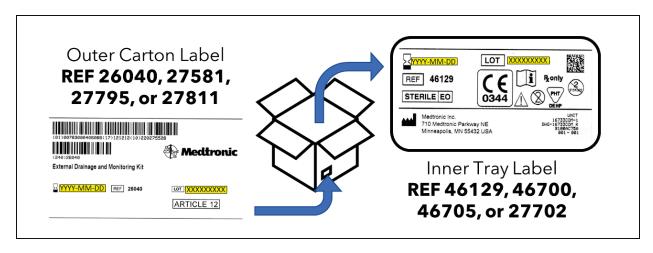


Figure 2 - Becker/Exacta EDMS Kit (outer carton) and Becker/Exacta EDMS Device (inner tray)

FA1452_GlobalA_RegionalAM1 Page 5 of 6

Medtronic

Medtronic International, Ltd. (Singapore Branch) (Co.Reg.No. S98FC5604C) 50 Pasir Panjang Road #04-51 Mapletree Business City

Tel: 165.6870.5300 Fax: 65.6482.0300

Singapore 117384

www.medtronic.com

Customer Confirmation Form

URGENT: MEDICAL DEVICE CORRECTION

Becker and Exacta External Drainage and Monitoring Systems
Potential for Stopcock Cracking and Leaking

Please complete all fields below and return all pages immediately

| Customer Contact Details | | Medtronic Contact Details | |
|---|----------------------------------|---------------------------|---|
| Distributor / Hospital / Clinic / Physician name: Address: | | Name: | |
| | | | Mobile no: |
| | | | Email: |
| Phone no: | Email: | | |
| | | • | Device Correction Notification Letter, dated xacta external drainage and monitoring systems |
| Please complete and sign th | e form as indicated below and | nand or scan then ema | il it back to your local Medtronic field representative |
| For any questions or assista | nce, please contact your local I | Medtronic field repres | entative. |
| Name (print): | Signature: | Stamp: | Date: |

Note: The addressee may continue to receive reminders of this notice until a response is received.

FA1452_GlobalA_RegionalAM1 Page 6 of 6